

RESIDENTIAL BUILDING SURVEY

Bedford, Bedfordshire. MK41



FOR

Mr K

Prepared by:

INDEPENDENT CHARTERED SURVEYORS

Marketing by:

www.1stAssociated.co.uk

0800 298 5424

CONTENTS

INTRODUCTION
REPORT FORMAT
SYNOPSIS

EXECUTIVE SUMMARY
SUMMARY UPON REFLECTION

EXTERNAL

CHIMNEY STACKS AND PARTY WALLS
ROOF COVERINGS AND UNDERLAYERS
ROOF STRUCTURE AND LOFT SPACE
GUTTERS AND DOWNPIPES AND SOIL AND VENT PIPES
EXTERNAL WALLS
FASCIAS AND SOFFITS AND WINDOWS AND DOORS
EXTERNAL DECORATIONS

INTERNAL

CEILINGS, WALLS, PARTITIONS AND FINISHES
CHIMNEY BREASTS
FLOORS
DAMPNESS
INTERNAL JOINERY
TIMBER DEFECTS
INTERNAL DECORATIONS
THERMAL EFFICIENCY
OTHER MATTERS

SERVICES

ELECTRICITY
GAS
PLUMBING AND HEATING
BATHROOM
MAIN DRAINS

OUTSIDE AREAS

GARAGE AND PARKING
EXTERNAL AREAS

POINTS FOR LEGAL ADVISOR

APPENDICES

LIMITATIONS
ELECTRICAL REGULATIONS
GENERAL INFORMATION ON THE PROPERTY MARKET

INTRODUCTION

Firstly, may we thank you for your instructions; we have now undertaken a Building Survey (formerly known as a Structural Survey) of the aforementioned property.

The Building Survey takes the following format; there is an introductory section (which you are currently reading), which includes a synopsis of the building, and a summary of our findings.

We then go through a detailed examination of the property starting with the external areas working from the top of the property down, followed by the internal areas and the buildings services. We conclude with the section for your Legal Advisor and also attach some general information on the property market.

We are aware that a report of this size is somewhat daunting and almost off-putting to the reader because of this. We would stress that the purchase of a property is usually one of the largest financial outlays made (particularly when you consider the interest you pay as well).

We recommend that you set aside time to read the report in full, consider the comments, make notes of any areas which you wish to discuss further and phone us.

We obviously expect you to read the entire report but we would suggest that you initially look at the summary, which refers to various sections in the report, which we recommend you read first so that you get a general feel for the way the report is written.

As part of our service we are more than happy to talk through the survey as many times as you wish until you are completely happy to make a decision. Ultimately, the decision to purchase the property is yours but we will do our best to offer advice to make the decision as easy as possible.

REPORT FORMAT

To help you understand our Report we utilise various techniques and different styles and types of text, these are as follows:

GENERAL/HISTORICAL INFORMATION

This has been given in the survey where it is considered it will aid understanding of the issues, or be of interest. This is shown in "italics" for clarity.

TECHNICAL TERMS DEFINED

Throughout the Report, we have endeavoured to define any technical terms used. This is shown in "Courier New" typeface for clarity.

A PICTURE IS WORTH A THOUSAND WORDS



We utilise photographs and sketches to illustrate issues or features. In some photographs a pencil has been used to highlight a specific area. The sketches are not 100% technically accurate; we certainly would not expect you to carry out work based upon the sketches alone.

ORIENTATION

Any reference to left or right is taken from the front of the property, including observations to the rear, which you may not be able to physically see from the front of the property.

ACTION REQUIRED AND RECOMMENDATIONS

We have used the term **ACTION REQUIRED** where we believe that there are items that you should carry out action upon or negotiate upon prior to purchasing the property.

Where a problem is identified, we will do our best to offer a solution. However, with most building issues, there are usually many ways to resolve them dependent upon cost, time available and the length of time you wish the repair/replacement to last.

SYNOPSIS

SITUATION AND DESCRIPTION

This is a modern two storey mid-terraced property set in an estate built at a similar era. There is a small garden to the front and a rear garden that is on a slope that is stepped with an adjoining single garage.

We believe that the property was built in circa 1970s. If the exact age of the property interests you your Legal Advisor may be able to find out more information from the Deeds.

Putting Life into Perspective!

Some of the things that were happening around the time the property was built:

1969	Man lands on the Moon
1971	Decimalisation
Early 1970s	British Property Boom
1973	Britain enters the European Economic Community
1977	Elvis Presley Dies
1978-1979	The Winter of Discontent
1979-1991	The Thatcher Years

EXTERNAL PHOTOGRAPHS



Front View



Rear View



A view to the front of the property



Garage and parking



Rear garden

Independent Chartered Surveyors

Marketing by: ———

www.1stAssociated.co.uk

0800 298 5424

ACCOMMODATION AND FACILITIES

Ground Floor

The ground floor accommodation consists of:

- Entrance Hall
- Lounge/Dining Room
- Kitchen

First Floor

The first floor accommodation consists of:

- Three bedrooms
- Family bathroom with a separate WC

Outside Areas

Garage and off street parking

INTERNAL PHOTOGRAPHS

The following photos are of the internal of the property to help you recall what it looked like and the general ambience (or lack of). We have not necessarily taken photographs of each and every room.

Ground Floor



Lounge



Lounge/Dining Room



Dining Room



Kitchen

First Floor



Front bedroom right hand side



Front bedroom right hand side



Bathroom



WC



Front left hand side bedroom



Rear right hand bedroom

SUMMARY OF CONSTRUCTION

External

Chimneys:	One brick chimney
Main Roof:	Pitched roof clad with concrete tile
Gutters and Downpipes:	Plastic
Soil and Vent Pipe:	Internal with a metal flue
Walls:	Stretcher bond (assumed) brickwork
Fascias and Soffits:	Plastic likely to be over clad
Windows and Doors:	Double glazed with trickle vents

Internal

Ceilings:	Plasterboard (assumed)
Walls:	Mixture of solid and studwork (assumed)
Floors:	Ground Floor: Solid under foot assumed concrete
	First Floor: Joist and floorboard (assumed)

Services

We believe that the property has a mains water supply, mains drainage, electricity and gas (assumed). The property has a Back boiler which was popular in the 1960s and the electrics are dated from the 1960s within the cupboard off the kitchen.

The above terms are explained in full in the main body of the Report.

We have used the term 'assumed' as we have not opened up the structure.

EXECUTIVE SUMMARY



Summaries are dangerous as they try to précis often quite complex subjects into a few paragraphs. This is particularly so in a summary about someone's future home when we are trying to second-guess what their priorities are, so it is important the Report is read in full.

It is inevitable with a report on a building of this nature that some of the issues we have focussed in on you may dismiss as irrelevant and some of the areas that we have decided are part of the 'character' of this property you may think are very important. We have taken in the region of fifty plus photographs during the course of this survey and many pages of notes, so if an issue has not been discussed that you are interested in or concerned about please phone and talk to us before you purchase the property (or indeed commit to purchasing the property), as we will more than likely have noted it and be able to comment upon it. If we have not we will happily go back.

Generally we found the property to be in slightly below average condition considering the property's age, type and style with a few exceptions. We have divided the Executive Summary into 'The Good', 'The Bad' and 'The Ugly', to help distinguish what in our mind are the main issues.

The Good

Survey reports often are full of only the faults and general 'doom and gloom', so we thought we would start with some positive comments on the property!

Good size modern property more spacious than a post 1980s development
Own garage and parking (although we did not have access to the garage)
We feel it was presented well (although this is superficial of course).

We are sure you can think of other things to add to this list.

The Bad

Problems / issues raised in the 'bad' section are usually solvable, but often need negotiation upon. However, a large number of them may sometimes put us off the property.

1) Over cladding

The fascias and soffits that we could see are finished in plastic. We believe this is over cladding, this is a system where plastic is put over the original timber, ironically it is often done because of rot in the timbers to make it more presentable and is always sold as never needing painting however unfortunately usually it traps in any dampness and causes the wood underneath it to rot even quicker.



Fascias and soffits – definitely looks like over cladding, plastic on left hand side and timber on right hand side.

ACTION REQUIRED: At some point you need to check whether the plastic is over cladding or has been replacement.

The easiest way we found to do this is either to remove some of the screw fixing points and check what they are screwed into or to drill into the plastic and see what residue you get from your drill. If you do find over cladding and if the timber beneath it is in poor condition we would recommend that it is replaced with proper cladding panels in plastic or timber, as long as it is done properly!

2) Cracking

We find today that people are more and more concerned with regard to cracking in a property and rightly so as often in the Bedford area where clay is a major consideration. The cracks that we noted internally were we are pleased to say original settlement or drying out cracks. These are particularly prominent in areas that have not been redecorated recently that are hidden such as the cupboards.



Cracking


ACTION REQUIRED: Fill with a pliable mastic and redecorate in due course.

3) **No hand rail on stairs**

Hand rail not present on the stairs, we would suggest at least one is added.

ACTION REQUIRED: Install hand rail.

ANTICIPATED COST: A few hundred pounds dependent on your DIY skills; quotations required.

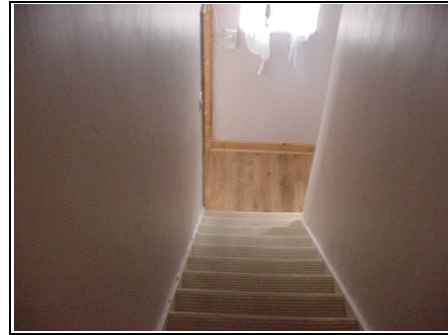

No hand rail on staircase

Please see the Internal Joinery Section of this Report.

4) **Kitchen flooring is not wall to wall**

As the kitchen flooring does not go all the way back to the perimeter walls water may get in beneath it.

ACTION REQUIRED: We would mastic seal around where the flooring ends or add in floor or you could, if you wish, completely re-floor.

ANTICIPATED COST: A few hundred pounds for the resealing suggestion more if you are re-flooring; quotations required.



Missing flooring in kitchen

Please see the Flooring Section of this Report.

5) **Garden**

Garden on a slope


The garden is on a slope which has been stepped and has retaining walls. The retaining walls do not have any weep holes.



No weep holes present

ACTION REQUIRED: Cut weep holes into walls to stop the build up of water behind them which eventually pushes them over and/or causes spalling

ANTICIPATED COST: £100; quotations required.

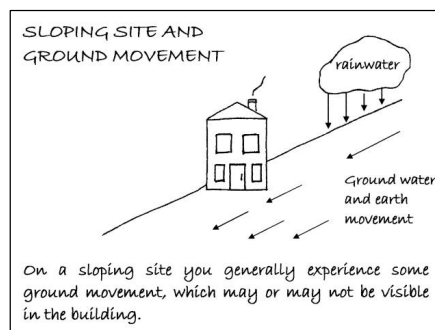

Uneven paving

The garden has uneven paving slabs and some are loose.



Loose paving slabs

ACTION REQUIRED: Lift and reposition paving slabs.

ANTICIPATED COST: £100-£200
DIY job; quotations required.

Please see the Garden Section of this Report.

6) Garage

We did not gain access to the garage which has an interesting mock Tudor feature to the end.

ACTION REQUIRED: You need to gain access to the garage prior to purchasing the property

Please see the Garage and Parking Section of this Report.



Garage

7) Services

Electrics

Fuse board

The electric fuse board is dated from 1960s and is rewirable fuse system which is no longer used.

ACTION REQUIRED: We recommend that the fuse board is replaced.



Out of date electrics

ANTICIPATED COST: In the region of £300-£500; quotations required.

DIY electrics

The conduit which gives electricity to the garage is sitting on the ground rather than being buried below it which does not meet NICEIC standards and is what we would term DIY electrics and does give us concern as to what else has been done and is why we would recommend a test and inspection.

ACTION REQUIRED: We recommend these are replaced and NICEIC tested and inspected and the electric conduit is repositioned.

ANTICIPATED COST: In the region of £350-£500 plus repositioning; quotations required.

Ceiling Lights

The older ceiling lights were renowned for causing fires where they let heat up into the fittings. You need to specifically request your electrician checks these when they do the NICEIC test. You may be OK and have a modern equivalent or you may not, you cannot tell when seeing them from the front.



Ceiling light


Please see the Services Section of this Report.

Heating

Single Panelled Radiators

We noted that some of the radiators are single panelled so the property may not heat up as quickly as you are used to.

ACTION REQUIRED: As heating is very subjective, particularly between males and females!, we would suggest that you live with the radiators for awhile and see if they warm up the rooms enough and if not replace the single panelled radiators.

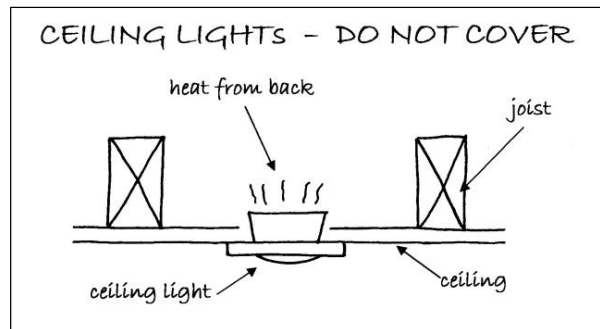

Single panelled radiator

ANTICIPATED COST: A few hundred pounds per radiator; quotations required.

Back Boiler

There is a Back boiler in this property, these were popular in the 1960s

although they are now dated. They are normally not as efficient as modern boilers but the good ones do seem to go on forever and spare parts are available.

ACTION REQUIRED: We suggest that you budget for a replacement boiler within the next few years. There really is no telling when these will go, you do need to get it serviced as soon as possible.

ANTICIPATED COST: In the region of £2000-£3000 dependent on the type you go for and also relocation costs; quotations required.

Please see the Services Section of this Report.

The Ugly

We normally put here things that we feel will be difficult to resolve and will need serious consideration.

There is nothing which we feel falls within this category.

Other Items

Moving on to more general information.

Electrics

Whilst we have carried out a visual inspection of the electrics (this is commented upon in the Electrics Section of the report) we also need to advise you of the following:

ACTION REQUIRED: As the property is changing occupancy the Institute of Electrical Engineers (IEE) recommend an NICEIC (or equivalent) registered and approved electrical contractor carry out an inspection, test and report.

Please see our specific comments in the Executive Summary

Maintenance

This type of property is relatively modern (i.e., less than one hundred years old) but nevertheless still requires ongoing maintenance and repair. A budget

Independent Chartered Surveyors

17

—— Marketing by: ——

www.1stAssociated.co.uk

0800 298 5424

for such work must be allowed to ensure it is maintained in a good condition. This will prevent undue and unnecessary deterioration.

DIY/Handyman Type Work

There are numerous other items that we would class as DIY or handyman type work such as redecorating to make the house into your home. We have detailed these and other issues within the main body of the report.

Purchase Price

We have not been asked to comment upon the purchase price in this instance, we have however referred you to sources of general information on the housing market within the Information on the Property Market Section, which can be found in the Appendices at the end of the Report.

Every Business Transaction has a Risk

Every business transaction has a risk, only you can assess whether that risk is acceptable to you and your circumstances. You should now read the main body of the Report paying particular attention to any “**ACTION REQUIRED**” points.

Estimates of Costs

Where we have offered an estimate of building costs please remember we are not experts in this area. We always recommend you obtain quotations for the large jobs before purchasing the property (preferably three quotes). The cost of building work has many variables such as the cost of labour. For unskilled labour we currently use between £75 and £100 per day (the higher costs in the city areas) and for tradesmen we use between £100 and £200 per day for an accredited, qualified, skilled tradesman. Other variations include the quality of materials used and how the work is carried out, for example off ladders or from scaffold.

If you obtain builders estimates that vary widely, we would advise the work is probably difficult or open to various interpretations and we would recommend a specification is prepared. It would probably be best to supervise the work if it is complex, both of which we can do if so required.

SUMMARY UPON REFLECTION



The Summary Upon Reflection is a second summary so to speak, which is carried out when we are doing the second or third draft a few days after the initial survey when we have had time to reflect upon our thoughts on the property. We would add the following in this instance:

As we discussed with you on the telephone and suggested that you visit the area and check that you are happy with the location further suggesting that you visit it during the 9 o'clock rush to work and the school/work return at night.

We would recommend that you check with your insurance prior to purchasing the property, as some areas of Bedford can be costly due to the clay that is beneath it and associated insurance claims for settlement and heave.

We did notice some Weeping Willow trees nearby which do mean that there is likely to be water in the area as Willows do not grow without there being a ready supply of water, that is why we normally see them next to a river bank.



As a general comment for any work required we would always recommend that you obtain at least three quotations for any work from a qualified, time served tradesperson or a competent registered building contractor prior to legal completion.

We would ask that you read the Report and contact us on any issues that you require further clarification on.

MORE ABOUT THE REPORT FORMAT

Just a few more comments about the Report format before you read the actual main body of the Report.

TENURE – FREEHOLD (OR AS GOOD AS)

We have assumed that the property is to be sold Freehold or Long leasehold, with no unusual or onerous clauses and that vacant possession will be available on completion. Your Legal Advisor should confirm that this is the case.

ESTATE AGENTS – FRIEND OR FOE?

It is important to remember that the estate agents are acting for the seller (usually known as the vendor) and not the purchaser and are therefore eager to sell the property (no sale – no fee!). We as your employed Independent Chartered Surveyor represent your interests only.

SOLICITOR/LEGAL ADVISOR

To carry out your legal work you can use a solicitor or a legal advisor. We have used both terms within the report.

TERMS OF ENGAGEMENT/LIMITATIONS

This report is being carried out under our terms of engagement for Residential Building Surveys, as agreed to and signed by yourselves. If you have not seen and signed a copy of our terms of engagement please phone immediately.

OUR AIM IS ONE HUNDRED PERCENT SATISFACTION

Our aim is for you to be completely happy with the service we provide, and we will try and help you in whatever way possible with your property purchase - just phone us.

**THE DETAILED PART OF THE REPORT
FOLLOWS, WORKING FROM THE TOP
OF THE PROPERTY DOWNWARDS**



Independent Chartered Surveyors


—— Marketing by: ——

www.1stAssociated.co.uk

0800 298 5424

EXTERNAL

CHIMNEY STACKS, FLUES AND PARTY WALLS

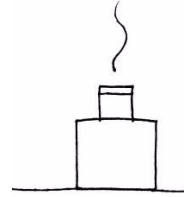

Chimney stacks

Chimneys developed originally from open fires placed within buildings. From this, the chimney has developed to its present day format where it is used as an aesthetic feature and focal point rather than purely just to heat the room.

This property has one chimney, which is located centrally on the property.

Chimney

This chimney is brick finished with no chimney pots with lead flashings. From what we could see the chimney looks in average condition. Unfortunately we were unable to see the top of the chimney known as the flaunchings we therefore cannot comment upon them.



Chimney One

Flaunchings Defined

A low, wide cement mortar fillet surrounding the flue terminal on top of the chimneystack to throw off rainwater.


Flashings Defined

Flashings prevent dampness from entering the property, usually at junctions where materials change. Such a junction is the one between the chimney and the roof.

Finally, we have made our best assumptions on the overall condition of the chimney stacks from the parts we could see. The inspection was made from ground level within the boundaries of the property (unless otherwise stated) using a x16 zoom lens on a digital camera. A closer inspection may reveal latent defects.

Please also see the Chimneybreasts, Flues and Fireplaces Section of this Report.

ROOF COVERINGS AND UNDERLAYERS

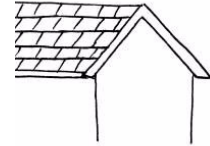

The Roof Coverings and Underlayers section considers the condition of the outer covering of the roof. Such coverings usually endure the extremes of climate and temperatures. They are susceptible to deterioration, which ultimately leads to water penetration.

The underlayer's function is to minimise wind and water damage. Dependent upon the age of your property this may or may not be present, please read on:

We will consider this roof in one area;

Main Roof


The roof is pitched and clad in a concrete tile. From what we could see the concrete tiles are lying level and true and look in reasonable condition. Sometimes we find that deterioration occurs to the ridge and exposed areas such as the perimeter and so you should periodically check these areas.



Concrete tile clad roof

Protective Underlayer (Often known as the sarking felt or underfelt)

From the 1940s onwards felts were used underneath tiles/slates to stop wind damage and water penetration, these in more recent years have been replaced with plastic equivalents. These are commonly known as underfelts but now the name is not really appropriate, as felt is not the only material used.

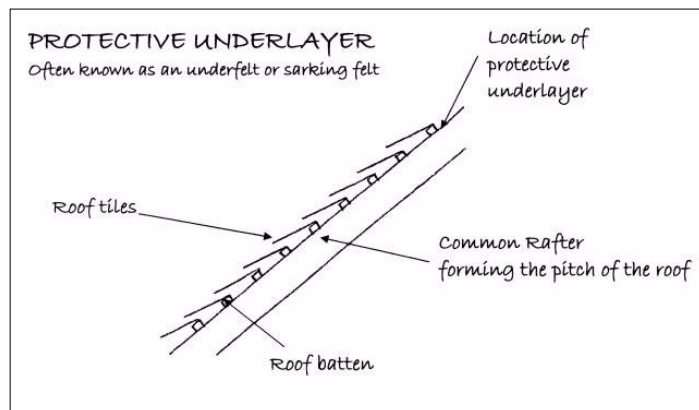

One is a Hessian base Bitumen membrane. This type of membrane has been used since the 1960s. We generally found it to be in average condition, average although it is damaged in a few places but this is not unusual considering its age.




This photo shows the common rafters (the ones that form the pitch of the roof) and the dark area between is the underlayer.

Finally, all the roofs were inspected from ground level with the aid of a x16 zoom lens on a digital camera. Unfortunately we were only able to see approximately ninety percent of the main roof properly from ground level via our ladder or via any other vantage point that we managed to gain. We have made our best conclusions based upon what we could see, however a closer inspection may reveal other defects.

For further comments with regard to ventilation please see the Roof Structure and Loft Section.

ROOF STRUCTURE AND LOFT



(ALSO KNOWN AS ROOF SPACE OR ATTIC SPACE)

The roof structure or framework must be built in a manner which is able to give adequate strength to carry its own weight together with that of the roof covering discussed in the previous section and any superimposed loads such as snow, wind, foot traffic etc.


Main Roof

Roof Access

The main roof is accessed via the loft hatch located in the front left hand bedroom. There is no loft ladder, roof light or secured floorboards. We recommend that these be added, as it will make the loft space safer and easier to use. The loft has been viewed by torch light, which has limited our viewing slightly.

Roof Structure

The roof has a semi pre fabricated roof, commonly used in the 1960s and 1970s, when we started to move away from the traditional purpose made roof structure, to a pre made factory manufacture roof truss, these where an early version of the pre fabricated truss commonly used today.

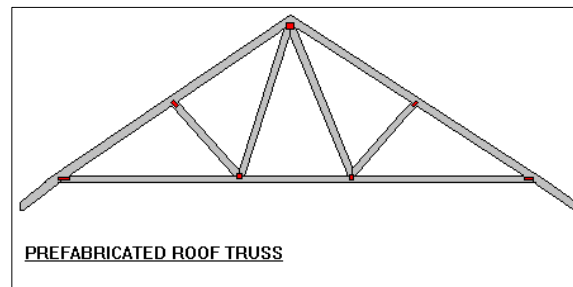

Roof Timbers

We found the roof timbers generally in average condition considering their age. We have inspected the roof structure for:

- Serious active woodworm
- Structurally significant defects to the timbers
- Structurally significant dry rot
- Structurally significant wet rot



Roof timbers

Our examination was limited by the general configuration of the roof, the insulation and stored items. As mentioned what we could see was generally found to be in average condition considering its age. If anything it would benefit from being vented. It is feasible that there are problems in the roof that are hidden.

ACTION REQUIRED: The only way to be 100 per cent certain is to have the roof cleared and checked.

Fire Walls

There are firewalls either side of this property, which is good practice. To the both the left and right hand side there are block firewalls, these look to be original.


Fire Walls Defined:

Fire walls help prevent the spread of fire through roofs and are now a requirement under the building regulations and generally considered good practice by us.

Water Tanks

The water tank is formed in plastic and we therefore assume they are relatively new (in surveying terms, in this instance, that is the last 30 years). It is insulation which unfortunately hides part of it.

We would always recommend that water tanks be drained down and cleared of any debris etc. (we have seen dead birds and other unmentionable things in these tanks). As you are cleaning your teeth with this water it is best that it is as clean as possible!

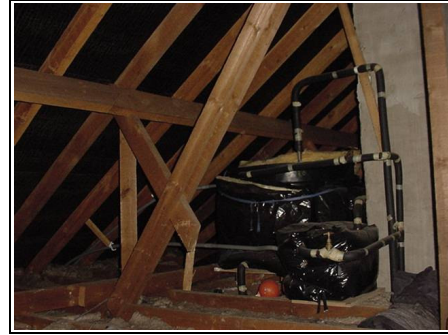

Water tanks

Ventilation

We did not see any vents to the roof to help prevent condensation and ultimately wet and dry rot.

ACTION REQUIRED: Add vents

Insulation

Please see the Thermal Efficiency Section of this Report.

Electrical Cables

We can often identify the age of an electrical installation by the age of wiring found in the roof. In this case please see our comments in the Executive Summary regarding the wiring to the ceiling lights



Please see our further comments in the Services Section of this Report.

Electric wiring in the roof to the ceiling lights

Finally, we would ask you to note that this is a general inspection of the roof, i.e. we have not examined every single piece of timber. We have offered a general overview of the condition and structural integrity of the area.

GUTTERS AND DOWNPIPES



The function of the gutters and downpipes is to carry rainwater from the roof to the ground keeping the main structure as dry as possible.

Defective gutters and downpipes are a common cause of dampness that can, in turn, lead to the development of rot in timbers. Regular inspection and adequate maintenance are therefore essential if serious problems are to be avoided.

Gutters and Downpipes

From ground level the gutters and downpipes looked to be plastic. Generally they appear in average condition, in this age of property the gutters are likely to have some minor leaks but most people can live with them.



Gutters and downpipes

ACTION REQUIRED: We would always recommend that the gutters and downpipes are cleaned out, the joints are checked and the alignment checked to ensure that the gutters fall towards the downpipes.

Soil and Vent Pipe


The soil and vent pipes are predominately internal, we can see at the roof level where it emerges and it is finished in lead although a very limited view due to the boxing in etc.



Internal soil and vent pipe

Finally, gutters and downpipes and soil and vent pipes have been inspected from ground level. As it was not raining at the time of the inspection it is not possible to confirm 100 per cent that the rainwater installation is free from blockage, leakage etc. or that it is capable of coping with long periods of heavy rainfall. Our comments have therefore been based on our best assumptions.


WALLS



External walls need to perform a variety of functions. These include supporting upper floors and the roof structure, resisting dampness, providing adequate thermal and sound insulation, offering resistance to fire and being aesthetically presentable.

Brickwork

The stretcher bond brickwork and pointing is in average condition where we can see it. The brickwork forms the outer skin and the inner walls are likely to be formed in blockwork and bonded to the brickwork outer walls with wall ties. This has been a common construction method since the 1960s.

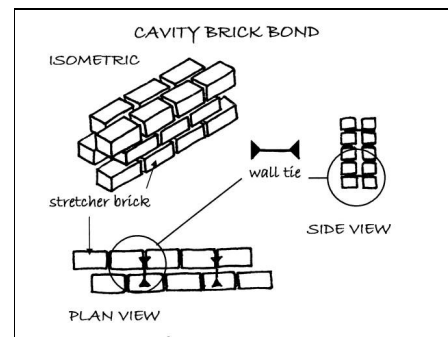

Problem with wall ties

In the earlier properties there can be problems with wall ties, this usually shows up with horizontal cracking, we cannot see any in this instance, however it is a progressive problem.



Brickwork

Render Panel

There is a render panel underneath the windows, this is in need of benefit from redecoration. Often the render panel areas can have a lower thermal efficiency than the brickwork and cause what is known as a cold bridge beneath the window.



Render panel

Finally, the external walls have been inspected visually from ground level and/or randomly via a ladder. Where the window and door lintels are concealed by brickwork/render/plasterwork we cannot comment on their construction or condition. In buildings of this age concrete lintels or metal lintels are common, which can be susceptible to deterioration that is unseen, particularly if in contact with dampness.

Our comments have been based upon how the brickwork/render/plasterwork has been finished. We have made various assumptions based upon what we could see and how we think the brickwork / render /plasterwork would be if it were opened up for this age, style and type of construction. We are however aware that all is not always as it seems in the building industry and often short cuts are taken. Without opening up the structure we have no way of establishing this.

FOUNDATIONS



The foundations function is, if suitably designed and constructed, to transfer the weight of the property through the soil. As a general comment, many properties prior to the 19th Century have little or no foundations, as we think of them today, and typically a two-storey property would have one metre deep foundations.

Foundations

Given that the properties age and type, we would expect to find a strip concrete foundation built up in blockwork to ground level where brick is used. As these are generally used as they are both quick and economical.

Bedford Clay

This property is likely to stand on Bedford Clay area as do the majority of properties in the Bedford. It is, therefore, more susceptible than most should drains leak or trees be allowed to overgrow, etc. It is not unusual to have some settlement.


Building Insurance Policy

You should ensure that the Building Insurance Policy contains adequate provision against any possibility of damage arising through subsidence, landslip, heave etc.

Finally, we have not excavated the foundations but we have drawn conclusions from our inspection and our general knowledge of this type, age and style of property.

As no excavation has been carried out we cannot be 100 percent certain as to how the foundation has been constructed and we can only offer our best assumptions and an educated guess, which we have duly done.



TREES

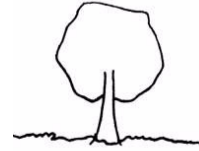

Trees within influencing distance of a property can affect the foundations by affecting the moisture content of the soil.

There are no trees within your garden that are within influencing distance of the main house.

There is a willow tree relatively close to the property and you need to get advice specifically on this tree. Please see our comments in the Summary upon Reflection.

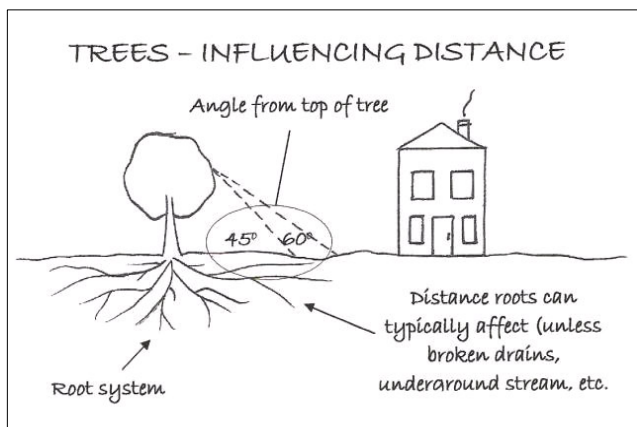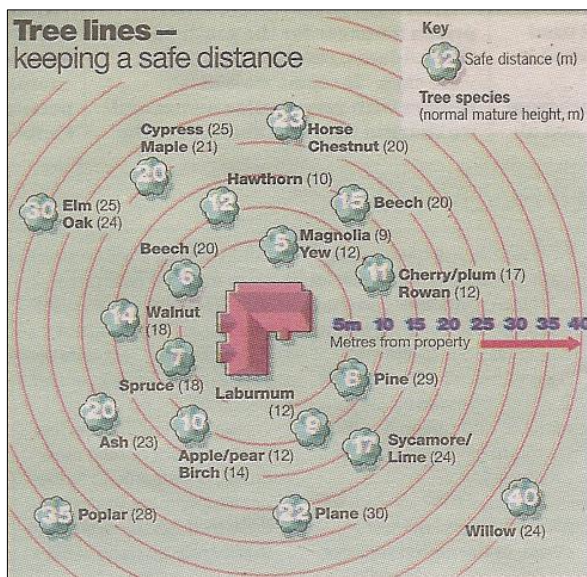

Influencing Distance Defined

This is the distance in which a tree may be able to cause damage to the subject property. It is not quite as simple as our sketch; it depends on the tree, its maturity, the soil type etc., etc.


Please also refer to the External Areas Section.

DAMP PROOF COURSE



The Building Act of 1878 required a damp proof course to be added to all newly built properties within the London area. It also required various other basic standards. These requirements were gradually taken up (or should that be grudgingly taken up) throughout London and then the country as a whole, although this took many years for it to become standard practice.

All modern properties should incorporate a damp proof course (DPC) and good building practice dictates that a differential of 150mm (6 inches) should be maintained between the damp proof course and ground levels. In this case, we could see a damp proof course to the property in some areas.

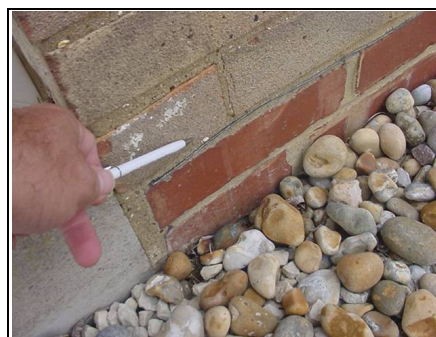

DPC

Please see the Dampness Section of this report.

Finally, sometimes it is difficult for us to identify if there is a damp proof course in a property. We have made our best assumptions based upon our general knowledge of the age, type and style of this property.

AIRBRICKS



In properties with suspended floors you need to have an airflow beneath to stop deterioration. The air is allowed to pass under the property by the use of airbricks. Generally the rule of thumb is that airbricks are spaced every metre and a half approximately, but this depends upon the specific circumstances of the property.

There is a low and high airbricks in the kitchen area, these are often used in years gone by to allow air circulation throughout the property.




High level Airbrick to rear

Finally, we have made our best assumptions based upon our visual inspection of the outside of the property and our general knowledge of this age, type and style of construction. We have not opened up the floor, unless we have specifically stated so in this section.



Low level airbrick

FASCIAS AND SOFFITS AND WINDOWS AND DOORS

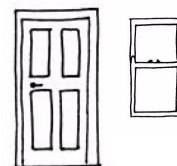

This section covers fascias, soffits and bargeboards, windows and doors, and any detailing such as brick corbelling etc.

Fascias and soffits offer protection to the rafter feet and also allow the securing of the guttering. Windows primary functions are to admit light and air, but they also have thermal and sound properties. The doors allow access and egress within the property.

Fascias and Soffits

The fascias and soffits are difficult to see but we do believe that they are plastic.

ACTION REQUIRED: We believe they are over cladding, please see our comments in the Executive Summary.



Fascias and Soffits

Windows and Doors

The property has plastic, double glazed windows these are of the older style modern double glazed windows will be more thermally efficient.

We would draw your attention to the fact that sealed double glazed units can fail, particularly as a result of poor workmanship during installation. Failure of the seal leads to condensation between the two panes of glass and simply replacing the affected units may not provide a satisfactory long-term solution. In this case they are in average condition.



Window

Enquiries should be made as to the existence of any transferable guarantees. Generally it is considered that double glazed units have a life of about ten years

Finally, we have carried out a general and random inspection of the fascias and soffits and windows and doors. In the case of the fascias and soffits it is typically a visual inspection from ground level. With the windows and doors we have usually opened a random selection of these during the course of the survey. In this section we are aiming to give a general overview of the condition of the fascias and soffits and windows and doors. Please also see the Internal Joinery section.



EXTERNAL DECORATIONS

The external decorations act as a protective coat for the building from the elements. Where this protective covering has failed, such as with flaking paintwork, the elements will infiltrate the structure. This is of particular concern as water is one of the major factors in damage to any structure.


You have next to no external redecoration to the actual house, with plastic covered fascias and soffits, plastic windows and doors but you do however have render which will need painting and a fence to the rear of the property that could do with staining.

Finally, ideally external redecoration is recommended every four to five years dependent upon the original age of the paint, its exposure to the elements and the materials properties. Where painting takes place outside this maintenance cycle repairs should be expected. Ideally redecoration should be carried out during the better weather between mid-April and mid-September.

Please see our comments in the Fascias and Soffits and Windows and Doors section.

INTERNAL

CEILINGS, WALLS, PARTITIONS AND FINISHES

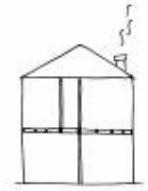

In this section we look at the finish applied to the structural elements such as the plasterwork applied to the ceiling joists, walls or partitions, together with the construction of the internal walls and partitions.

Ceilings

In this age of property you would expect plasterboard ceilings which is what we found in the area that we inspected. We would also expect some hair line cracking around the plasterboard please see our comments in the Executive Summary.

Plasterboard Defined

The usual name for Gypsum plasterboard, which is building board with a core of aerated gypsum, usually enclosed between two sheets of heavy paper, used as a dry lining.

Internal Walls and Partitions

We have carried out a tap test to the internal walls (this is not rocket science, it is literally tapping the walls and listening for the sound made) and found them to be a mixture of solid walls and hollow/studwork walls.

Generally it is a reasonable assumption that the solid walls are likely to be made from blockwork and will be the structural walls, with the studwork walls being purely to divide the rooms.

Perimeter Walls


Generally perimeter walls are finished with a modern plaster believed to be carlite / gypsum plaster and decorated. Without the removal of the decorative finish we cannot be 100 per cent certain, but this type of plaster is used in most modern properties.

ACTION REQUIRED: Please see the comments in the Executive Summary

Finally, ceilings, walls and partitions have been inspected from floor level and no opening up has been undertaken (unless permission has been obtained by yourselves). In some cases the materials employed cannot be ascertained without samples being taken and damage being caused.

We cannot comment upon the condition of the structure hidden behind plaster, dry lining, other applied finishes, heavy furniture, fittings and kitchen units with fitted back panels.

CHIMNEY BREASTS, FLUES AND FIREPLACES

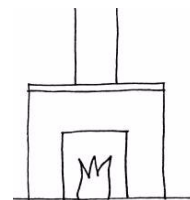

With the advent of central heating fireplaces tend to be more a feature than an essential function in most properties.

The chimney breasts are located to the middle/ centre of the building (all directions given as you face the front of the property).

At the time of the survey no chimneys were in use. Any chimneys that you do not propose to use should be capped and ventilated to prevent dampness.

Finally, it is strongly recommended that flues be cleaned and checked for obstruction prior to use to minimise the risk of hazardous fumes entering the building.

Please also see the Chimneystacks, Flues and Parapet Walls section of this Report.


FLOORS



Functionally floors should be capable of withstanding appropriate loading, preventing dampness, have thermal properties and durability. In addition to this upper floors should offer support for ceilings, resistance to fire and resistance to sound transfer.

It is fairly standard that the ground floor is solid and firm underfoot assumed concrete although it has laminate covering on most of it.

The first floor in this age of property we assume it is joist and floorboard sheets.

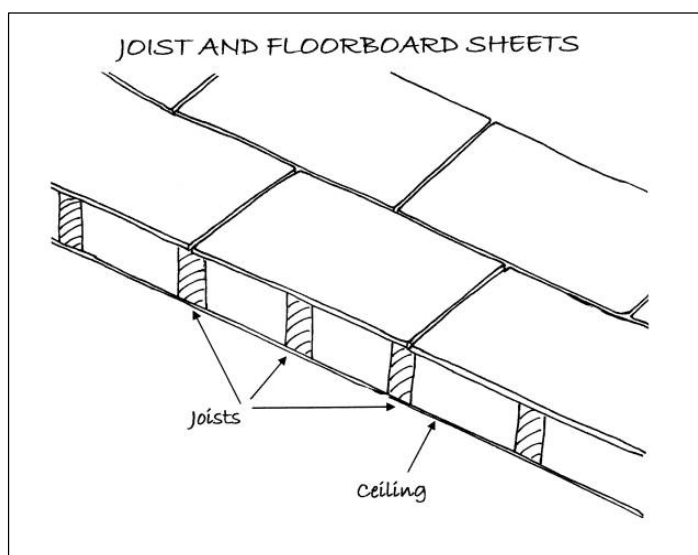

Finally, we have not been able to view the actual floors themselves due to them being covered with fitted carpets, floor coverings etc. In some areas we have the exposed polished timber floors. The comments we have made are based upon our experience and knowledge of this type of construction. We would emphasise that we have not opened up the floors in any way or lifted any floorboards.

DAMPNESS




In this section we look at any problems that are being caused by dampness. It is therefore essential to diagnose the source of the dampness and to treat the actual cause and not the effect of the dampness.

Rising Damp

Rising damp depends upon various components including the porosity of the structure, the supply of water and the rate of evaporation of the material, amongst other things. Rising damp can come from the ground, drawn by capillary action, to varying degrees of intensity and height into the materials above.


There is now much debate over whether true rising damp does exist after research over a 10 year period.

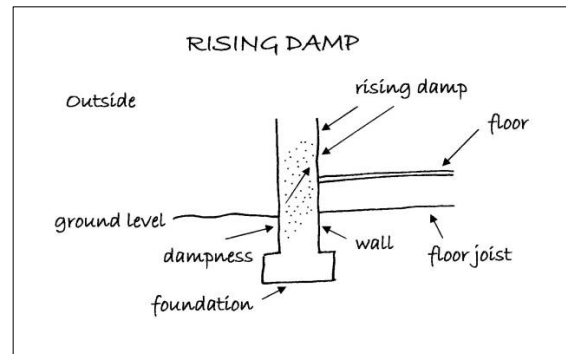

No evidence of any significant rising dampness was detected in the random areas checked.

Lateral or Penetrating Dampness

This is where water ingress occurs through the walls. This can be for various reasons such as poor pointing or wall materials or inadequate gutters and downpipes, such as poorly jointed gutters.

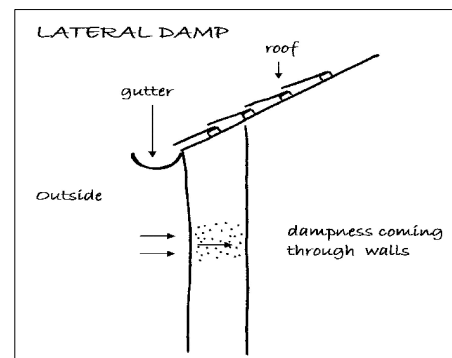

A visual inspection was carried and tests were taken with an electronic conductivity meter at selected points to walls. No significant penetrating/lateral dampness was seen or detected considering the properties age type and style.



Dampness test

Condensation


This is where the humidity held within the air meets a cold surface causing condensation.

We can see no obvious signs of condensation, however, the property has a relatively small bathroom, which do tend to promote condensation.

Condensation depends upon how you utilise the building. If you do your washing and then dry it in a room without opening a window you will, of course, get condensation. Common sense is needed and a balance between heating and ventilation of properties. Normally opening windows first thing in the morning resolves most condensation issues.

Finally, effective testing was prevented in areas concealed by heavy furniture, fixtures such as kitchen fittings with backboards, wall tiles and wall panelling. We have not carried out tests to BRE Digest 245, but only carried out a visual inspection.

INTERNAL JOINERY

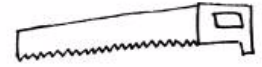

This section looks at the doors, the stairway, the skirting boards and the kitchen to give a general overview of the internal joinery's condition.

Doors

The property has timber doors they look solid.



Internal timber door

Staircase

Please see our comments in the Executive Summary

Kitchen


From our cursory visual inspection the kitchen looked in average to good condition. We have not tested any of the kitchen appliances.



Kitchen

Finally, it should be noted that not all joinery has been inspected. We have viewed a random sample and visually inspected these to give a general over-view of the condition. Please also see the External Fascias and Soffits and Windows and Doors Section.

TIMBER DEFECTS

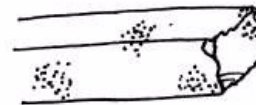

This section considers dry rot, wet rot and woodworm. Wet and Dry rot are species of fungi, both need moisture to develop and both can be very expensive to correct. We would also add that in our experience they are also often wrongly diagnosed.

Dry Rot

*Dry rot is also sometimes known by its Latin name *Serpula lacrymans*. Dry rot requires constant dampness together with a warmish atmosphere and can lead to extensive decay in timber.*

In the areas visually inspected no evidence was found of any significant dry rot. Please remember we have not opened up the floors.

Wet Rot

*Wet rot, also known by its Latin name *Contiophora puteana*, is far more common than dry rot. Wet rot darkens and softens the wood and is most commonly seen in window and doorframes, where it can relatively easily be remedied. Where wet rot affects the structural timbers in a property, which are those in the roof and the floor areas, it is more serious.*

In the areas visually inspected no evidence was found of any significant wet rot. Please remember we have not opened up the floors.

In this case some of the floors have been covered with a laminate flooring.



Woodworm

Active woodworm can cause significant damage to timber. There are a variety of woodworm that cause different levels of damage with probably the worst of the most well known being the Death Watch Beetle. Many older properties have woodworm that is no longer active; this can often be considered as part of the overall character of the property.

The roof is the main area that we look for woodworm. Within the roof we found no obvious visual signs of significant woodworm activity or, indeed, signs of past woodworm activity that has caused what we would term 'structurally significant' damage.

In many properties there is an element of woodworm that is not active. Our inspection is usually restricted by insulation covering some of the timbers and

general stored items in the roof, and roof configuration, as it is restricted throughout the property by general fixtures and fittings.

ACTION REQUIRED: If you wish to be 100 percent certain get the property checked when it is empty of fixtures, fittings and furniture, etc.

Finally, when you move into the property, floor surfaces should be carefully examined for any signs of insect infestation when furniture and floor coverings are removed together with stored goods. Any signs that are found should be treated to prevent it spreading. However, you need to be aware that many damp and woodworm treatment companies have a vested interest in selling their products and therefore have fairly cleverly worded quotations where they do not state if the woodworm they have found is 'active'. You should ask them specifically if the woodworm is active or not.

We would also comment that any work carried out should have an insurance backed guarantee to ensure that if the company does not exist, or for whatever reason, the guarantee is still valid. More importantly it is essential to ensure that any work carried out is carried out correctly.

INTERNAL DECORATIONS



With paints it should be remembered that up to 1992 lead could be used within paint and prior to this most textured paints (commonly known as Artex) contained an element of asbestos up to 1984, so care should be taken if the paintwork looks old and dated.

The decoration is average, with minor marks as you would expect in a home that's been lived in. You may wish to redecorate to your own personal taste.

It is very difficult to advise on how frequently redecoration should take place, as it very much depends upon the use and abuse the decoration gets, for example, hallways will need tending to more often than a spare bedroom.

Finally, we would draw your attention to the fact that removal of existing decorative finishes may cause damage to the underlying plasterwork necessitating repairs and making good prior to redecoration.

THERMAL EFFICIENCY



Up until the mid 1940s we did not really consider insulation in properties, for example it was only in the 1960s that we started putting insulation in the roof and then it was about 50mm, in the 1970s this was upgraded to 100mm. Then we started to think about double glazing and cavity wall insulation. Since then insulation standards have increased considerably and today we are looking at typically using insulation not only in the roof but also in the walls, floors and windows and more recently considerable work has been carried out on how efficient boilers are within properties. Care has to be taken that properties are not insulated disproportionately to the ventilation as this can cause condensation and you should be aware that you need to ventilate any property that is insulated.

HIPs (Home Information Packs) Report

We understand that HIPs were suspended from 20th May 2010. Energy Performance Certificates are required before a sale completes.

Roof Insulation

Some roof insulation was present, although not too current Building Regulation requirements of 270mm. In this instance you have approximately 150mm.

Walls

This property has a cavity wall construction, it is likely to have insulation but given the age of the property it was also the era when they were starting to add insulation without opening up the wall, we cannot be certain.

Windows

The windows are double glazed and therefore have reasonable thermal properties.

Services

Independent Chartered Surveyors

—— Marketing by: ——

www.1stAssociated.co.uk

0800 298 5424

Service records should be obtained. It is essential for the services to be regularly maintained to run efficiently.

Summary

The 1970s was when we really started to consider thermal insulation. Overall, provided our assumptions correct and considering the properties age, type and style, it has average thermal properties for what we see but refer to your HIPs report.

Further information can be obtained with regard to energy saving via the Internet on the following pages:


[HTTP//www.est.org.uk](http://www.est.org.uk), which is by the Energy Saving Trust and includes a section on grant aid.

or alternatively www.cat.org.uk

or www.ecocentre.org.uk for an alternative technological view.

Finally, we would advise that an energy rating is required for future house sales.

What does my energy bill pay for?

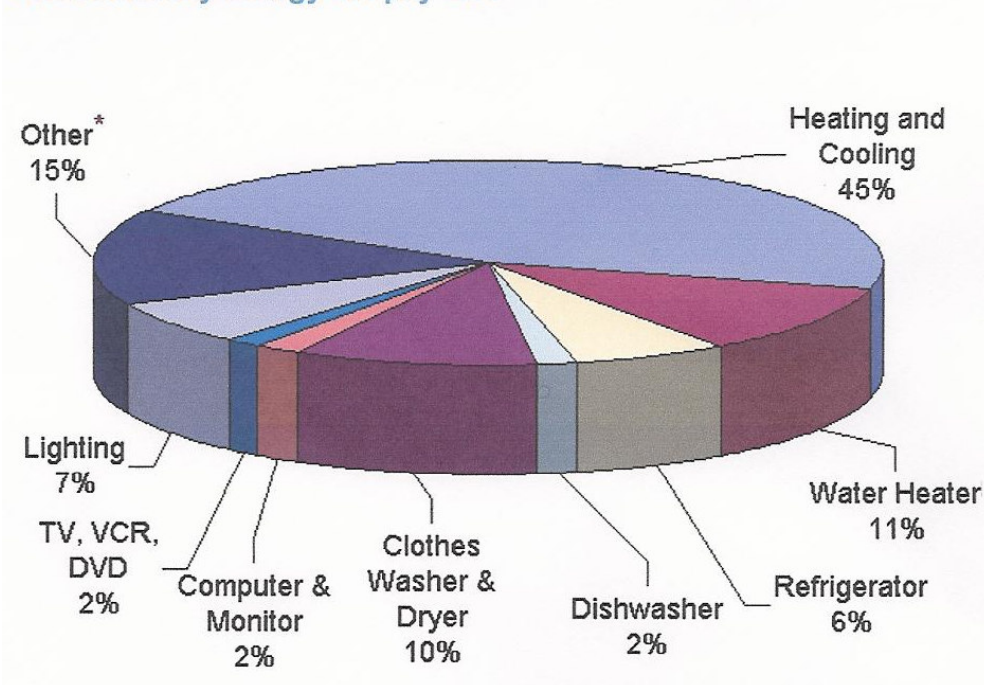

*"Other" represents an array of household products, including stoves, ovens, microwaves, and small appliances. Individually, these products account for no more than about 2% of a household's energy bills.

OTHER MATTERS



In this section we put any other matters that do not fit under our usual headings.

Security System

We did not note a security system within the house. It is a personal decision as to whether you feel one is necessary. We are not experts in this field and therefore cannot comment further. We suggest you contact a member of NACOSS (National Approval Council for Security Services), obtainable through directory enquiries, or your local Police Force for advice on a security system.

Fire Systems and Smoke Alarms

One battery operated smoke detector was noted. The current Building Regulations require that they be wired into the main power supply. Obviously in a property of this age this is difficult, as it would mean having surface mounted wires or cutting wiring into the plaster.

ACTION REQUIRED: We would recommend, for your own safety, that smoke detectors be installed. We have seen recently a smoke detector that fits within a light fitting (although we have not used these personally), which is charged when the light is switched on (providing it is switched on a certain number of times a year). We feel this is an excellent idea as it alleviates the problems of batteries running out. We also like the radioactivated fire/smoke alarms. We would also advise that if you wish to have any general advice the local Fire Authority are usually happy to help.

Insurance

We would always recommend staying with the existing insurance company, and then if there are any problems you should not have the difficulty of negotiating with two insurance companies passing the blame between each other, particularly in the area where there is clay.

Asbestos

Given the age of this property you may have asbestos, as it was once used almost as generally as wood. For example to the service ducts and fascia boards and soffits

We are finding that generally buyers are unhappy to purchase property with any defective asbestos. We have inspected for visible damaged/ degrading asbestos, (no tests have been taken) and not found any. See asbestos article www.1stAssociated.co.uk

ACTION REQUIRED: We are not specialist asbestos surveyors.

If you want to be 100% free of asbestos you need a specialist asbestos survey, where samples are taken.

You should, note that work involving products containing asbestos is covered by Health and Safety legislation and you are recommended to seek the advice of the Local Authority Environmental Health Officer before proceeding with any such work.

SERVICES

This survey does not include any specialist reports on the electricity supply and circuits, heating or drainage, as they were not requested. The comments that follow are based upon a visual inspection carried out as part of the overall Building Survey.

Services and specialist installations have been visually inspected. It is impossible to examine every detail of these installations without partially dismantling the structure. Tests have not been applied. Conclusive tests can only be undertaken by suitably qualified contractors. The vendor/seller should be requested to provide copies of any service records, test certificates and, ideally, the names and addresses of the installing contractors.

ELECTRICITY



It is strange to think that electricity only started to be used in domestic properties at the turn of the 19th century with gas lighting still being the norm for a good many years after.

Periodic inspections and testing of electrical installations is important to protect your property from damage and to ensure the safety of the occupants. Guidance published by the Institute of Electrical Engineers (IEE) recommends that inspections and testing are undertaken at least every 10 years (we recommend every five years) and on change of occupancy. All electrical installation works undertaken after 1st January 2005 should be identified by an Electrical Installation Certificate.

Fuse Board

The electric fuses and consumer units were located in the kitchen. We would date the fuse board as being from the 1960s. Rewireable fuses are now superseded. Far better fuse boards are now available.

ACTION REQUIRED: Replace the fuse board as soon as possible.



Fuse board

Earth Test

We carried out an earth test in the kitchen area to the socket point that is normally used for the kettle and this proved satisfactory.

ACTION REQUIRED: As the property is changing occupancy an IEE report should be carried out by a NICEIC registered and approved electrical contractor.




Earth Test

In addition to this your Legal Advisor is required to make full enquires with the owners to establish if any electrical installation work has been carried out and to provide suitable certification for any works carried out after 1st January 2005. Any comments made within this report or verbally do not change this requirement.

For basic general information on this matter please see the appendices at the end of this report.

GAS



There is very little we can check for in a gas installation, we do inspect to make sure there is one and that it has a consumer unit and that the boilers are vented. Ideally you should have a service inspection carried out by a Gas Safe registered heating engineer.

All gas appliances, pipework and flues should be the subject of an annual service by a Gas Safe registered heating engineer; works to any gas appliance by an unregistered person is illegal. Unless evidence can be provided to confirm that there has been annual servicing we would recommend that you commission such a service prior to use to ensure safe and efficient operation.

ACTION REQUIRED: As a matter of course it is recommended that the entire gas installation is inspected and made good, as necessary, by a Gas Safe registered contractor. Thereafter the installation should be serviced annually.

PLUMBING AND HEATING



In this section we do our best from a visual inspection to look at how the water is supplied to the property, how the supply is distributed around the property, how it is used to heat the property and how it is discharged from the property.

Water Supply

Assumed mains water supply

Water Pressure

When the taps were run to carry out the drainage tests we checked the pressure, literally by putting a finger over a tap, and the pressure seemed typical of what we find.

The Water Board have to guarantee a certain pressure of water to ensure that things like boilers, particularly the instantaneous ones, have a constant supply of pressured water (they would blow up if they didn't!).

We have not used a listening stick to check for water leaks

Cold Water Cistern

Please see our comments in the Roof Section.

Hot Water Cylinder

The hot water cylinder is relatively new (in this case we mean in the past 30 years) as it is factory lagged.



Hot water cylinder

Plumbing

The plumbing, where visible, comprises copper pipework. No significant leakage was noted on the surface, although most of the pipework is concealed in ducts and floors.

Boiler

We believe the property has a back boiler, which is located behind the fire place in the chimney. We do not know the manufacturer. It is essential a service history is obtained as this will help establish the condition of the boiler.

Heating

Our limited inspection of the hot water and central heating system revealed no evidence to suggest any serious defects, but we would nevertheless recommend that the system be tested and overhauled before exchange of contracts and that a regular maintenance contract be placed with an approved heating engineer.

Ten Minute Heating Test


As there was no one present at the property we have not had the benefit of carrying out a heating test.

ACTION REQUIRED: You need to check and ensure that the heating is working before you purchase the property or reduce the cost of the property by £3000 to allow for the insulation of a new boiler system, may be more if you have to replace the radiators.

Finally, it should be noted that the supply pipe from the Water Company stopcock to the internal stop tap is the responsibility of the property owner.

We cannot comment on the condition of the water service pipe to the building. It should be appreciated that leaks can occur for some time before signs are apparent on the surface.

BATHROOM

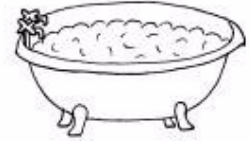

In this section we consider the overall condition of the sanitary fittings such as the bathroom, the kitchen, the utility room and the cloakroom.

The bathroom suite, looks in average condition, however it is smallish, and therefore could be prone to condensation.

Finally, although we may have already mentioned it above we would reiterate that it is important to ensure that seals are properly made and maintained at the junctions between wall surfaces and baths and showers etc. We normally recommend that it is one of the first jobs that you carry out as part of your DIY on the property, as water getting behind sanitary fittings can lead to unseen deterioration that can be costly, inconvenient and difficult to repair.

MAIN DRAINS



The sanitary system, as we know it now, came into being some 100 years ago during the Victorian era and works so successfully today it is often taken for granted. It is only in recent years that re-investment has taken place to upgrade the original drainage systems.

It is assumed that the property has mains drainage and that the foul drains discharge into a public sewer; this should be confirmed by your Legal Advisor prior to exchange of contracts, who should also provide information in respect of any common or shared drains including liability for the maintenance and upkeep of the same.

The cold taps have been run for approximately quarter of an hour in the bathroom and kitchen. No build up or back up was noted.

Inspection Chambers / Manholes

For your information, inspection chambers / manholes are required to be provided in the current Building Regulations at each change of direction or where drainage runs join the main run.

We have not found any man holes/ inspection chambers or rodding eyes, this is unusual.

ACTION REQUIRED: You need to ensure your legal advisor carries out a full drainage check.

Rainwater/Surface Water Drainage

Whilst very innocent looking rainwater downpipes can cause lots of problems. If they discharge directly onto the ground they can affect the foundations and even if they are taken away to soak-aways they can attract nearby tree roots or again affect foundations.

Some rainwater drains are taken into the main drainage system, which is now illegal (as we simply do not have the capacity to cope with it), and can cause blockages to the main drains! Here we have done our best from a visual inspection to advise of any particular problems.

We have been unable to determine the ultimate means of rain/surface water disposal, in this age of property it should be via a soak away but is not for certain.

Finally, rain/surface water drains have not been tested and their condition or effectiveness is not known. Similarly, the adequacy of soak-aways has not been established although you are advised that they tend to silt up and become less effective with time.

Please also see our comments within the Gutters and Downpipes section.

OUTSIDE AREAS


GARAGES AND PARKING



Single garage and off road parking to the rear.
We have not had access to this, you do need to
gain access before you purchase the property.



EXTERNAL AREAS

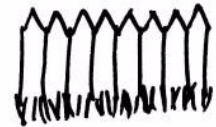

Front Garden

Small front garden



Rear Garden

The rear garden is on a slope that is stepped.
Please see our comments about adding weep
holes to the retaining walls and also our
comments about staining the fencing.



Boundaries: The left hand boundary (all directions given as you face the property) is usually the responsibility of the subject property.

Independent Chartered Surveyors

—— Marketing by: ——

www.1stAssociated.co.uk

0800 298 5424

Finally, whilst we note the boundaries, these may not be the legal boundaries. Your Legal Advisor should make further enquiries on this point and advise you of your potential liability with regard to any shared structures, boundary walls and fences.

Neighbours

Left Hand Neighbours

There was no answer when we knocked.

Right Hand Neighbours

There was no answer when we knocked.

POINTS FOR YOUR LEGAL ADVISOR

If you wish to proceed with your purchase of the property a copy of this report should be forwarded to your Legal Advisor and the following points should be checked by him/her:

- a) Responsibility for boundaries.
- b) Rights for you to enter onto the adjacent property to maintain any structure situated near or on the boundary and any similar rights your neighbour may have to enter onto your property.
- c) Obtain any certificates, guarantees or approvals in relation to:
 - i) Timber treatments, wet or dry rot infestations.
 - ii) Rising damp treatments.
 - iii) Cavity wall insulation and cavity wall tie repairs.
 - iv) Double glazing or replacement windows.
 - v) Roof and similar renewals.
 - vi) Central heating installation.
 - vii) Planning and Building Regulation Approvals.
 - viii) Any other matters pertinent to the property.
- d) Confirm that there are no defects in the legal Title in respect of the property and all rights associated therewith, e.g., access.
- e) Rights of Way e.g., access, easements and wayleaves.
- f) Liabilities in connection with shared services.
- g) Adjoining roads and services.
- h) Road Schemes/Road Widening.
- i) General development proposals in the locality.
- j) Conservation Area, Listed Building, Tree Preservation Orders or any other Designated Planning Area.

- k) Confirm from enquiries that no underground tunnels, wells, sewers, gases, mining, minerals, site reclamation/contamination etc., exist, have existed or are likely to exist beneath the curtilage of the site upon which the property stands and which could affect the quiet enjoyment, safety or stability of the property, outbuildings or surrounding areas.
- l) Our Report assumes that the site has not been put to contaminative use and no investigations have been made in this respect.
- m) Any outstanding Party Wall Notice or the knowledge that any are about to be served.
- n) Most Legal advisors will recommend an Envirosearch or a similar product is used by you to establish whether the area falls within a flood plain, old landfill site, radon area etc. If your Legal Advisor is not aware of Envirosearch or similar please ensure that they contact us and we will advise them of it. Any general findings should be brought to their logical conclusion by using appropriate specialist advisers.

However, with regard to Envirosearch or similar general reports please see our article link on the www.1stAssociated.co.uk Home Page.

- o) Any other matters brought to your attention within this report.

LOCAL AUTHORITY ENQUIRIES

Your Legal Advisor should carry out Local Authority searches to ascertain whether the property is a Listed Building and whether it is situated in a Conservation Area. They should also find out any information available with regard to Planning Applications and Building Control. We have not made any formal or informal Local Authority enquiries.

Finally, your Legal Advisor should carry out any additional enquiries they feel necessary and if they find anything unusual or onerous then we ask that they contact us immediately for our further comments.

It is our policy not to offer a conclusion to ensure that the Building Survey is read in full and the comments are taken in context.

If you would like any further advice on any of the issues discussed (or indeed any that have not been discussed!) then please do not hesitate to contact us on **0800 298 5424**.

REFERENCES

The repair and maintenance of houses
Published by Estates Gazette Limited

Life expectancies of building components
*Published by Royal Institution of Chartered Surveyors and
Building Research Establishment*

Surveying buildings
*By Malcolm Hollis published by Royal Institution of
Chartered Surveyors Books.*

House Builders Bible
By Mark Brinkley, Published by Burlington Press

APPENDICES

Independent Chartered Surveyors

—— Marketing by: ——

www.1stAssociated.co.uk

0800 298 5424

LIMITATIONS

Our limitations are as the agreed Terms and Conditions of Engagement.

CONDITIONS OF ENGAGEMENT

The report has been prepared in accordance with our Conditions of Engagement and should be regarded as a comment on the overall condition of the property and the quality of its structure and not as an inventory of every single defect. It relates to those parts of the property that were reasonably and safely accessible at the time of the inspection, but you should be aware that defects can subsequently develop particularly if you do not follow the recommendations.

ENGLISH LAW

We would remind you that this report should not be published or reproduced in any way without the surveyor's expressed permission and is governed by English Law and any dispute arising there from shall be adjudicated upon only by the English Courts.

SOLE USE

This report is for the sole use of the named Client and is confidential to the Client and his professional advisors. Any other persons rely on the Report at their own risk.

ONLY HUMAN!

Although we are pointing out the obvious, our Surveyors obviously can't see through walls, floors, heavy furniture, fixed kitchen units etc. they have therefore made their best assumptions in these areas.

As this is a one off inspection, we cannot guarantee that there are no other defects than those mentioned in the report and also that defects can subsequently develop.

WEATHER

It was dry and slightly overcast at the time of the inspection. The weather did not hamper the survey.

Our weather seems to be moving towards the extremities from relatively mid range. A few interesting facts in Britain over the years have been:

2000	Wettest year on record at the time
2003	Driest year on record at the time
2004	Wettest August on record at the time
2004	Boscastle was the worst flash flood on record at the time
2005	Third driest year on record at the time
2006	Warmest year recorded on record at the time
July 2006	Hottest July on record at the time
2006	Hottest autumn on record at the time
2007	Warmest spring on record at the time
2007	Wettest June on record at the time
April '06-April '07	Hottest 12 months on record at the time
2008	
2009	Third wettest August since 1956
2010	Heaviest snowfall in March since 1991
	Britain faces one of the coldest winters for 100 years

References BBC News www.bbc.co.uk

This may have adverse effects on lots of buildings in years to come.

EMPTY PROPERTY

The property was empty at the time of our survey, we were therefore not able to carry out our usual question and answer session or have our questionnaire filled out.

INSPECTION LIMITED

Unfortunately in this instance our inspection has been very limited due to no one being at the property for us to have a question and answer session and to fill out our questionnaire on the property. Also we did not have the benefit of meeting you which we find always helps and we would be more than happy to meet you at the property if you so wish.

TERMS AND CONDITIONS

Our computer system sends two copies of our Terms and Conditions to the email address given to us when booking the survey; one has the terms attached and the other has links to the Terms and Conditions on our website (for a limited time). If you have not received these please phone your contact immediately.

THE ELECTRICAL REGULATIONS – PART P OF THE BUILDING REGULATIONS

Here is our quick guide to the Regulations, but please take further advice from a qualified and experienced electrician.

From 1st January 2005, people carrying out electrical work in homes and gardens in England and Wales must follow new rules in the building regulations. All significant electrical work carried out in the home will have to be undertaken by a registered installer or be approved and certified by the local authority's building control department. Failure to do so will be a legal offence and could result in a fine. Non-certified work could also put your household insurance policy at risk.

If you can't provide evidence that any electrical installation work complies with the new regulations, you could have problems when it comes to selling the property.

There will be two ways in which to prove compliance:

1. A certificate showing the work has been done by a Government-approved electrical installer - British Gas or NICEIC Electrical Contractor.
2. A certificate from the local authority saying that the installation has approval under the building regulations.

Homeowners will still be able to do some minor electrical jobs themselves. To help you, we've put together this brief list of dos and don'ts.

Work You Cannot do Yourself

- Complete new or rewiring jobs.
- Fuse box changes.
- Adding lighting points to an existing circuit in a 'special location' like the kitchen, bathroom or garden.
- Installing electrical earth connections to pipework and metalwork.
- Adding a new circuit.

INFORMATION ON THE PROPERTY MARKET

We used to include within our reports articles on the property market that we thought would be of interest and informative to you, however we were concerned that in some cases these did not offer the latest information. We have therefore decided to recommend various websites to you, however it is important to realise the vested interest the parties may have and the limits to the information.

www.landreg.org.uk

This records the ownership of interests in registered land in England and Wales and issues a residential property price report quarterly, which is free of charge. The Land Registry is a Government body and records all transactions as far as we are aware, although critics of it would argue that the information is often many months out of date.

www.rics.org.uk

The Royal Institution of Chartered Surveyors offer quarterly reports via their members. Although this has been criticised as being subjective and also limited, historically their predictions have been found to be reasonably accurate.

www.halifax.co.uk and www.nationwide.co.uk

Surveys have been carried out by these two companies, one now a bank and the other a building society for many years. Information from these surveys is often carried in the national press. It should be remembered that the surveys only relate to mortgaged properties, of which it is generally considered represents only 75% of the market. It should also be remembered that the national coverage of the two companies differs and that they may be offering various incentives on different mortgages, which may taint the quality of information offered. That said they do try to adjust for this, the success or otherwise of this is hard to establish.

www.hometrack.co.uk

Independent Chartered Surveyors

—— Marketing by: ——

www.1stAssociated.co.uk

0800 298 5424

From what we can see this is an internet based company who say they offer independent property research (in fact they say they are the only independent company), although they also advise that they are part of a property related group that has bought and sold over 60 million pounds worth of residential property, which indicates that they may have a vested interest. They do also comment that they have carried out their own independent surveys and they have at least two Hometrack recommended estate agents in each postcode area. We would refer you to the 'About us' section within their website to understand better where their information is coming from. We would comment that we have been pleasantly surprised with the quality of information provided by the company.

Motleyfool.co.uk

We also like the Motley Fool website which is a general financial site and although it is selling financial services and other services they do tend to give a very readable view of the housing market.

<http://www.nethouseprices.com/>

This website offers information on land registry recorded property sales, by postcode or address.

www.globrix.com

This is a very good website for seeing the prices of properties for sale in a certain postcode area.